CINCINNATI MINE MACHINERY CO.
THE STRONGEST LINK.™

LC-5154-48-B LADDER CHAIN

CHAIN UNITS REQUIRED	REV	-

MINER WITH STRIGHT DISCHARGE - 65 UNITS

MINER WITH SIDE DISCHARGE:
MINER CHAIN - 45 UNITS
SIDE DISCHARGE - 28 UNITS

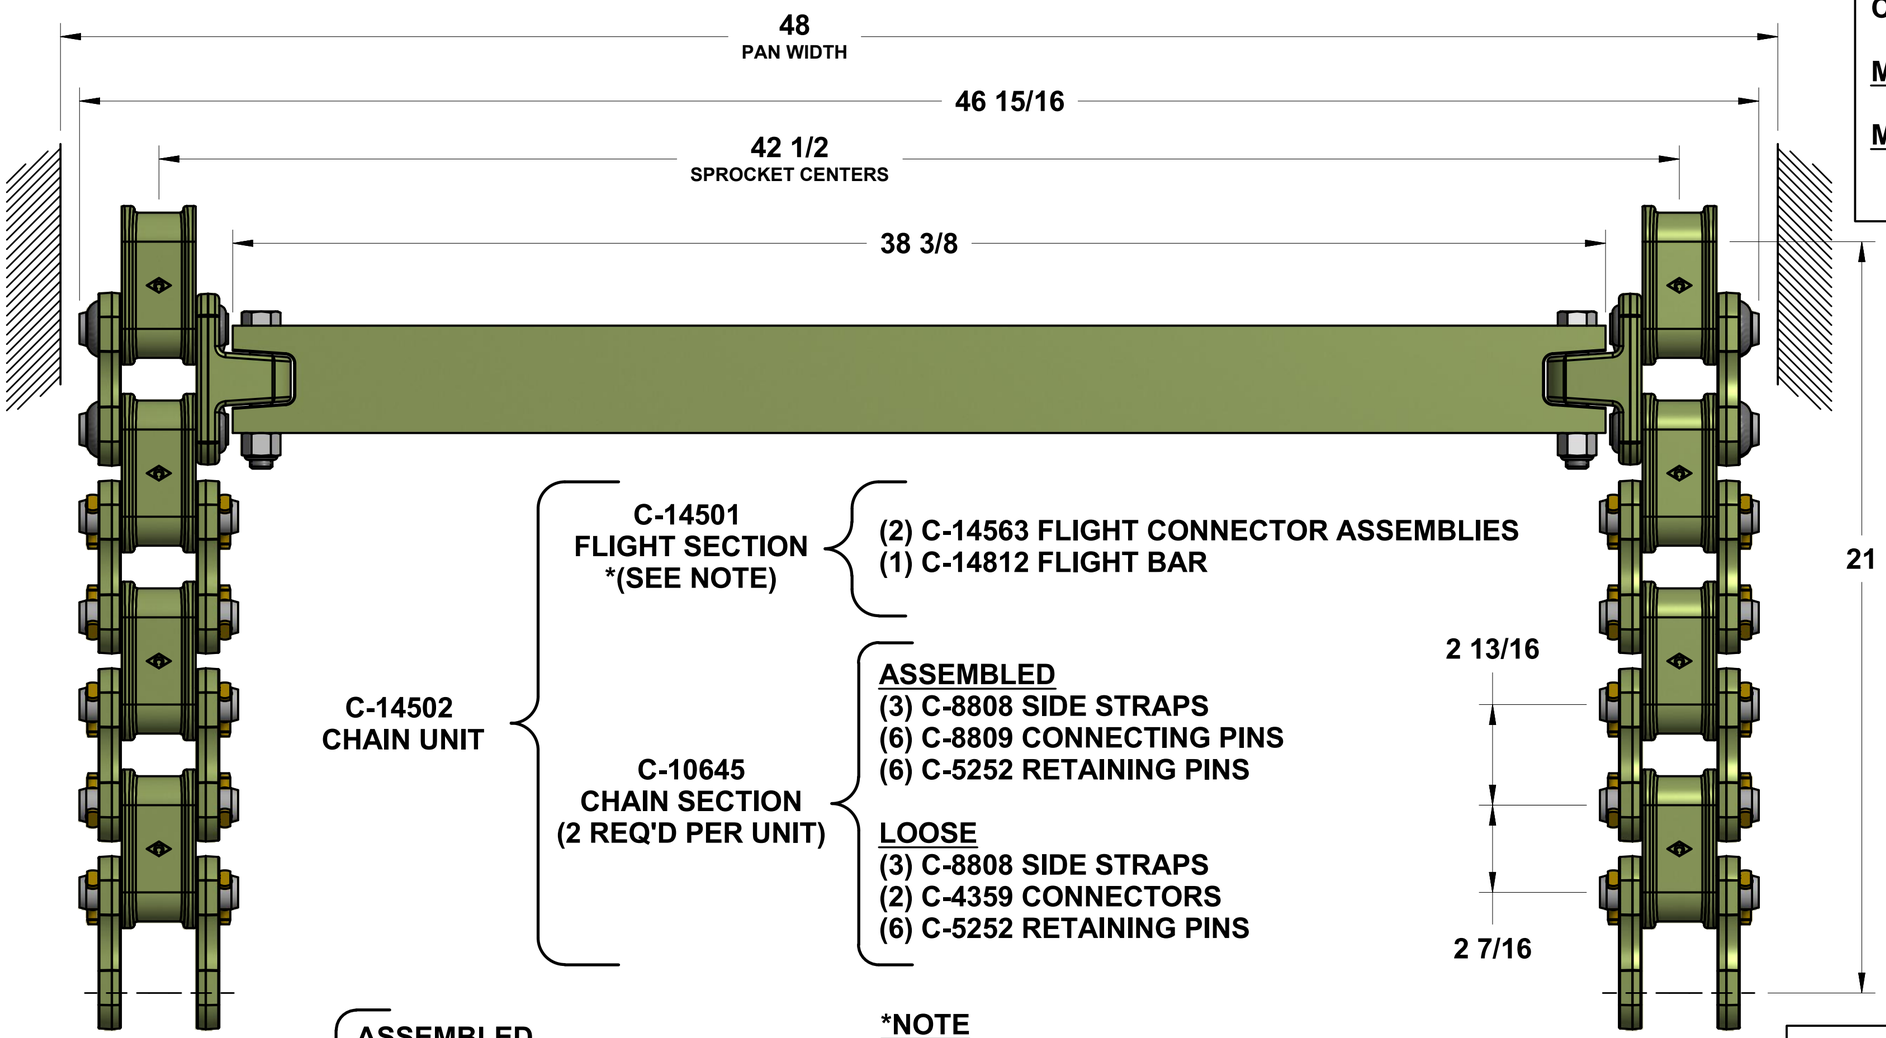

C-14501
FLIGHT SECTION
*(SEE NOTE)
- (2) C-14563 FLIGHT CONNECTOR ASSEMBLIES
- (1) C-14812 FLIGHT BAR

C-14502
CHAIN UNIT

C-10645
CHAIN SECTION
(2 REQ'D PER UNIT)

ASSEMBLED
- (3) C-8808 SIDE STRAPS
- (6) C-8809 CONNECTING PINS
- (6) C-5252 RETAINING PINS

LOOSE
- (3) C-8808 SIDE STRAPS
- (2) C-4359 CONNECTORS
- (6) C-5252 RETAINING PINS

C-8808
SIDE STRAP

C-4359
CONNECTOR

C-5252
RETAINING PIN

C-8809
CONNECTING PIN

C-14696
HEX NUT - GRADE 8
5/8-11 NyLoc

C-14695
HEX BOLT - GRADE 8
5/8-11 UNC x 4"

C-10363
SIDE STRAP
ASSEMBLY
(NOT SHOWN)

ASSEMBLED
- (1) C-8808 SIDE STRAP
- (2) C-8809 CONNECTING PINS
- (2) C-5252 RETAINING PINS

LOOSE
- (1) C-8808 SIDE STRAP
- (2) C-5252 RETAINING PINS

***NOTE**
C-14563 FLIGHT CONNECTOR IS A WELDMENT
AND IS ONLY SUPPLIED FULLY ASSEMBLED

C-14690
CHAIN REPAIR UNIT
(2 REQ'D)
- (1) C-14563 FLIGHT CONNECTOR ASSEMBLY (PER SIDE)
- (1) C-10645 CHAIN SECTION (PER SIDE)
- (FULLY ASSEMBLED AS SHOWN)

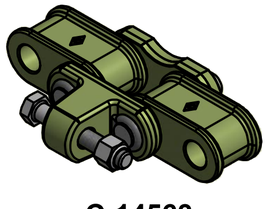

C-14563
FLIGHT CONNECTOR ASSEMBLY
*(SEE NOTE)

C-14129
4 TOOTH SPROCKET

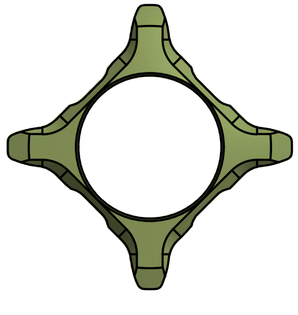
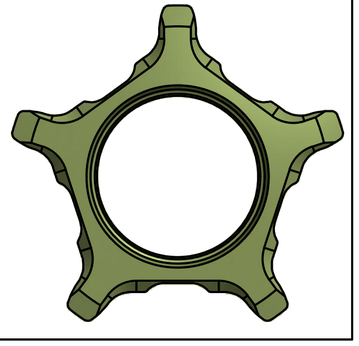
C-5741
5 TOOTH SPROCKET