



THE CINCINNATI MINE MACHINERY Co.

DA-350 CONVEYOR CHAINS

MAINTENANCE & INSTALLATION INSTRUCTIONS




WARNING

NEVER INVERT FLIGHTS



THIS WILL CAUSE DAMAGE TO SPROCKET



WE OFFER SCRAPER FLIGHTS
TO USE AS DECK CLEANERS
*CALL FOR PART NUMBERS:
1-800-543-4607

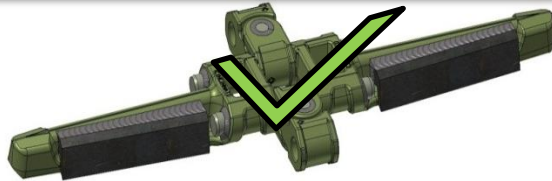

NEVER INVERT SIDE STRAPS

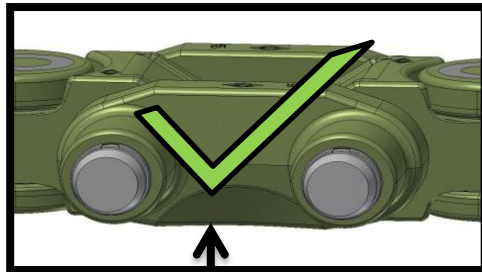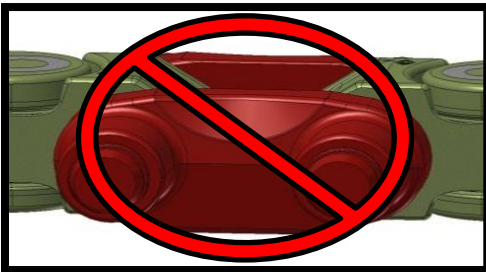

RELIEF BEVEL MUST BE DOWN AS SHOWN

Visit www.cinmine.com For More Information



THE CINCINNATI MINE MACHINERY Co.

DA-350 CONVEYOR CHAINS


TENSIONING & INSTALLATION INSTRUCTIONS



WARNING

DEFINITION OF PROPERLY TENSIONED CHAIN

THE LEAST AMOUNT OF TENSION THAT KEEPS
THE CHAIN ON THE SPROCKETS & OUT OF THE
CLA'S AT ALL TIMES

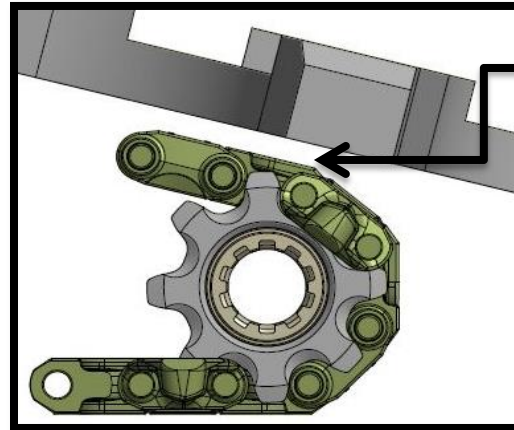


NOTICE

IF LESS THAN 3/4"
CLEARANCE BETWEEN
CLA'S AND FLIGHTS THEN
A SHIM MAY BE NEEDED
UNDER THE CLA'S

INDICATOR: WHEN BOOM IS STRAIGHT YOU SHOULD BE
ABLE TO ROTATE FLIGHTS BY HAND 2 - 4 INCHES AS SHOWN

2" - 4"

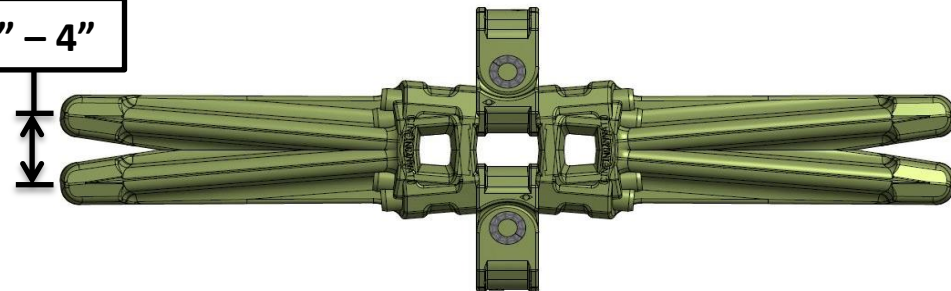

Visit www.cinmine.com For More Information